



SHUNT TRIPPER MANUAL

EPBA-MX



Step 1

Take out the MX shunt tripper from the individual box and check the "handle connection pin" and "thin core pin" on the MX or not.



- ←
- 1 Handle connection pin
 - 2 Thin core pin


Step 2

Take out 4pcs "location piece" from the plastic bag.




Step 3

Put those 4pcs* locaction piece* on right side of the MX shunt tripper,see as below.

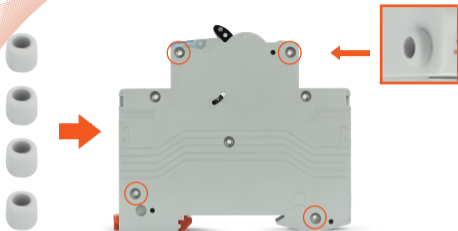

Step 4

Connect the MX shunt tripper on the left side of the MCB.

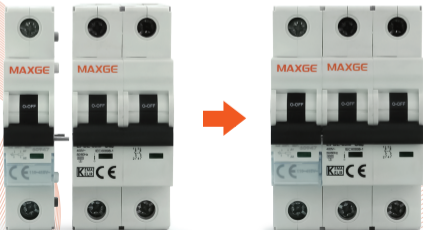


Step 5

:Take out 2 Pcs "plastic connection" from the plastic bag to connect the MX shunt tripper to MCB as below.

↓   Connect the Upper part of the MCB and MX shunt tripper.



↑   Connect the Down part of the MCB and MX shunt tripper.

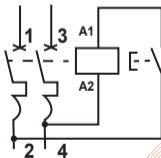

WARNING

Wiring diagram must according to above diagram, otherwise, the MX coil will burn!